

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Reclamation District No. 0536 Egbert

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Lindsey Slough	Right	5.58	03/30/2016 03/30/2016	Herman Phillips

LM Start		Rating **	M	Issue No.	38
LM End		Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Flood Preparedness & Training			°	°
				°	°
DWR ID	DWR_RD0536_01_s _ 2012_38				
Comment Code					
Inspector Comment					
The District does not have a staff only land owners.					

No Photos

LM Start		Rating **	M	Issue No.	39
LM End		Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals			°	°
				°	°
DWR ID	DWR_RD0536_01_s _ 2012_39				
Comment Code					
Inspector Comment					
District needs to get a copy of the O&M manual.					

No Photos

LM Start		Rating **	M	Issue No.	40
LM End		Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			°	°
				°	°
DWR ID	DWR_RD0536_01_s _ 2012_40				
Comment Code					
Inspector Comment					
The district should keep a supply of floodfight materials.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Reclamation District No. 0536 Egbert

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Lindsey Slough	Right	5.58	03/30/2016 03/30/2016	Herman Phillips

LM Start	0.02	Rating **	A/W	Issue No.	21
LM End	1.05	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.244968 °	38.254798 °
				-121.768630 °	-121.757680 °
DWR ID	DWR_RD0536_01_f_2015_21				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Looking downstream from levee mile 0.02-1.05 no vegetation problems.					

Photo 1 of 1 : SP_2016_RD0536_208_21_20160516_00040.jpg



RD 536 Unit 1 looking downstream from levee mile 0.02 to 0.22.

LM Start	0.05	Rating **	A	Issue No.	19
LM End	1.05	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.244980 °	38.254798 °
				-121.767982 °	-121.757680 °
DWR ID	DWR_RD0536_01_s_2016_19				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	0.25	Rating **	M	Issue No.	22
LM End	0.25	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			38.245463 °	38.245463 °
				-121.764528 °	-121.764528 °
DWR ID	DWR_RD0536_01_s_2014_22				
Comment Code					
PR : Prunings					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Reclamation District No. 0536 Egbert

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Lindsey Slough	Right	5.58	03/30/2016 03/30/2016	Herman Phillips

LM Start	0.67	Rating **	M	Issue No.	3
LM End	0.98	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	2015 USACE Erosion Survey, DRAFT			38.249615 °	38.253717 °
				-121.760165 °	-121.757979 °
DWR ID	DWR_RD0536_01_s_2016_3				
Comment Code					
Inspector Comment					
2011 - Multiple sections of slumping bank. 2015: Site is part of the extended inventory, last inspected 2011. [2015 Site ID: LDS_0-6_R]					

No Photos

LM Start	1.10	Rating **	U	Issue No.	31
LM End	2.60	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.255475 °	38.256395 °
				-121.757598 °	-121.738608 °
DWR ID	DWR_RD0536_01_s_2016_31				
Comment Code					
V9 : Keep the crown roadway free of vegetation.					
Inspector Comment					
Remove the tall weeds from the crown roadway, the crown should be free of vegetation.					

Photo 1 of 1 : SP_2016_RD0536_208_31_20160516_00046.jpg



RD 536 Unit 1 looking downstream from levee mile 1.10 - 2.60 tall weeds growing on the crown roadway.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Reclamation District No. 0536 Egbert

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Lindsey Slough	Right	5.58	03/30/2016 03/30/2016	Herman Phillips

LM Start	1.11	Rating **	U	Issue No.	32
LM End	5.57	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.255533 °	38.245595 °
				-121.757595 °	-121.697653 °
DWR ID	DWR_RD0536_01_s_2016_32				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove the tall grasses from the landside levee slope.					

Photo 1 of 1 : SP_2016_RD0536_208_32_20160516_00043.jpg



RD 536 Unit 1 looking at the landside slope from levee mile 1.11- 5.57 the tall grasses completely covering the levee slope.

LM Start	1.11	Rating **	M	Issue No.	33
LM End	1.15	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.255660 °	38.256246 °
				-121.757600 °	-121.757580 °
DWR ID	DWR_RD0536_01_s_2016_33				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Control the grasses on the waterside levee slope.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Reclamation District No. 0536 Egbert

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Lindsey Slough	Right	5.58	03/30/2016 03/30/2016	Herman Phillips

LM Start	1.15	Rating **	U	Issue No.	34
LM End	4.25	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.256246 °	38.248888 °
				-121.757581 °	-121.718091 °
DWR ID	DWR_RD0536_01_s_2014_34				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove the unwanted tall grasses, arundo and other wild growth from the waterside levee slope and toe					

Photo 1 of 1 : SP_2016_RD0536_208_34_20160516_00044.jpg



RD 536 Unit 1 levee mile 1.15-4.25 tall grasses and other wild growth covering the waterside slope and toe.

LM Start	1.35	Rating **	M	Issue No.	47
LM End	1.55	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Crown Surface / Depressions / Rutting			38.258930 °	38.258637 °
				-121.757085 °	-121.753397 °
DWR ID	DWR_RD0536_01_f_2014_47				
Comment Code					
C1 : Add appropriate material and re-grade the levee to bring the crown above the design elevation.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Reclamation District No. 0536 Egbert

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Lindsey Slough	Right	5.58	03/30/2016 03/30/2016	Herman Phillips

LM Start	2.69	Rating **	U	Issue No.	56
LM End	2.71	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Crown Surface / Depressions / Rutting			38.255197 °	38.254973 °
				-121.737932 °	-121.737577 °
DWR ID	DWR_RD0536_01_f_2014_56				
Comment Code					
C1 : Add appropriate material and re-grade the levee to bring the crown above the design elevation.					
Inspector Comment					
District need to monitor the levee crown roadway at this location. There are some issues here. This will involve more than adding material. What's causing the separation needs to be examined.					

Photo 1 of 3 : SP_2016_RD0536_208_56_20160223_00009.jpg



Looking downstream at crown roadway there is still some settling going on here at this location.

LM Start	2.69	Rating **	U	Issue No.	56 (cont)
LM End	2.71	Issue Type +	Ma	Location *	CR

Photo 2 of 3 : SP_2016_RD0536_208_56_20160223_00010.jpg



Close up view of the uneven settling of the crown roadway.

LM Start	2.69	Rating **	U	Issue No.	56 (cont)
LM End	2.71	Issue Type +	Ma	Location *	CR

Photo 3 of 3 : SP_2016_RD0536_208_56_20160516_00041.jpg



The crown roadway has some settling issues that can't be viewed due to the tall grasses allowed to grow on the crown.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	---	--	---	--	--	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Reclamation District No. 0536 Egbert

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Lindsey Slough	Right	5.58	03/30/2016 03/30/2016	Herman Phillips

LM Start	2.74	Rating **	M	Issue No.	62
LM End	2.74	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.254927 °	38.254927 °
				-121.737139 °	-121.737138 °
DWR ID	DWR_RD0536_01_s _ 2014_62				
Comment Code					
T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					

No Photos

LM Start	2.95	Rating **	M	Issue No.	63
LM End	2.95	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			38.256098 °	38.256098 °
				-121.733720 °	-121.733720 °
DWR ID	DWR_RD0536_01_s _ 2014_63				
Comment Code					
T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					

No Photos

LM Start	4.55	Rating **	U	Issue No.	44
LM End	4.96	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.249110 °	38.245648 °
				-121.713052 °	-121.708125 °
DWR ID	DWR_RD0536_01_s _ 2016_44				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove the wild growth from the water side levee slope and toe levee mile 4.55 to 4.96.					

Photo 1 of 1 : SP_2016_RD0536_208_44_20160516_00045.jpg



RD 536 Unit 1 looking downstream from levee mile 4.55-4.96 unwanted tall weeds covering the waterward slope and toe.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Reclamation District No. 0536 Egbert

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Lindsey Slough	Right	5.58	03/30/2016 03/30/2016	Herman Phillips

LM Start	4.61	Rating **	U	Issue No.	45
LM End	4.96	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.248548 °	38.245648 °
				-121.712273 °	-121.708125 °
DWR ID	DWR_RD0536_01_s _ 2016_45				
Comment Code					
V9 : Keep the crown roadway free of vegetation.					
Inspector Comment					
Remove the unwanted tall weeds from the crown roadway as the crown should be free from vegetation.					

Photo 1 of 1 : SP_2016_RD0536_208_45_20160516_00047.jpg



RD 536 Unit 1 looking downstream from levee miles 4.61 to 4.96 weeds taller than 5-foot growing on the crown roadway.

LM Start	4.94	Rating **	M	Issue No.	4
LM End	4.95	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	2015 USACE Erosion Survey, DRAFT			38.245581 °	38.245667 °
				-121.708605 °	-121.708327 °
DWR ID	DWR_RD0536_01_s _ 2016_4				
Comment Code					
Inspector Comment					
2011 - Multiple erosion pockets from tree popouts. A smaller erosion pocket in the middle of a failing bank repair. Pump structure at the downstream end may be contributing to the erosion. 2015: Site is part of the extended inventory, last inspected 2011. [2015 Site ID: LDS_0-8_R]					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Reclamation District No. 0536 Egbert

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Lindsey Slough	Right	5.58	03/30/2016 03/30/2016	Herman Phillips

LM Start	5.00	Rating **	M	Issue No.	6
LM End	5.05	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	2015 USACE Erosion Survey, DRAFT			38.245981 °	38.246326 °
				-121.707609 °	-121.706737 °
DWR ID	DWR_RD0536_01_s_2016_6				
Comment Code					
Inspector Comment					
2011 - Levee toe is unraveling with large slumping sections. This site is downstream of old bank rock. 2012 - Erosion pocket has increased in size. 2015: Site is part of the extended inventory, last inspected 2011. [2015 Site ID: LDS_0-7_R]					

No Photos

LM Start	5.45	Rating **	U	Issue No.	70
LM End	5.53	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.245565 °	38.245503 °
				-121.699808 °	-121.698480 °
DWR ID	DWR_RD0536_01_f_2014_70				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
District need to remove the wild growth from the waterward levee slope and shoulder.					

Photo 1 of 1 : SP_2016_RD0536_208_70_20160223_00012.jpg



Unsatisfactory growth of young tree growth present on the waterside levee slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Reclamation District No. 0536 Egbert

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Yolo Bypass	Right	5.01	03/30/2016 03/30/2016	Herman Phillips

LM Start	0.10	Rating **	M	Issue No.	11
LM End	0.28	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.244097 °	38.241570 °
				-121.696952 °	-121.697305 °
DWR ID	DWR_RD0536_02_f_2015_11				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Control the wild weeds on the waterside levee slope.					

No Photos

LM Start	0.11	Rating **	U	Issue No.	8
LM End	4.48	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.244040 °	38.197090 °
				-121.696950 °	-121.701027 °
DWR ID	DWR_RD0536_02_s_2016_8				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Control the tall weeds on the landside levee slope and toe, there haven't been any maintenance done on this section of levee.					

Photo 1 of 1 : SP_2016_RD0536_209_8_20160516_00017.jpg



RD 536 Unit 2 looking downstream from levee mile 0.11 to 4.48 tall weeds completely covering the landside levee slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	--	--	--	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Reclamation District No. 0536 Egbert

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Yolo Bypass	Right	5.01	03/30/2016 03/30/2016	Herman Phillips

LM Start	0.11	Rating **	U	Issue No.	15
LM End	2.17	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.243965 °	38.214507 °
				-121.696933 °	-121.693970 °
DWR ID	DWR_RD0536_02_f_2015_15				
Comment Code					
V9 : Keep the crown roadway free of vegetation.					
Inspector Comment					
The crown roadway should be free from vegetation at all times.					

Photo 1 of 1 : SP_2016_RD0536_209_15_20160516_00020.jpg



RD 536 Unit 2 levee mile 0.11 - 0.86 crown roadway overgrown with tall weeds.

LM Start	0.84	Rating **	M	Issue No.	16
LM End	2.20	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Crown Surface / Depressions / Rutting			38.233467 °	38.214050 °
				-121.698007 °	-121.693725 °
DWR ID	DWR_RD0536_02_f_2012_16				
Comment Code					
C3 : Add appropriate gravel or road base. Grade and compact.					
Inspector Comment					
Add appropriate gravel or road base					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Reclamation District No. 0536 Egbert

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Yolo Bypass	Right	5.01	03/30/2016 03/30/2016	Herman Phillips

LM Start	2.17	Rating **	U	Issue No.	2
LM End	4.36	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.214579 °	38.196442 °
				-121.693950 °	-121.698978 °
DWR ID	DWR_RD0536_02_f_2015_2				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove the dead weeds from the waterward levee section.					

Photo 1 of 1 : SP_2016_RD0536_209_2_20160223_00001.jpg



Unsatisfactory wild growth of weeds on the waterside levee slope and shoulder.

LM Start	2.61	Rating **	U	Issue No.	13
LM End	4.38	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			38.208542 °	38.196558 °
				-121.690903 °	-121.699284 °
DWR ID	DWR_RD0536_02_s_2016_13				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					
Mow and spray the crown roadway to keep it free of vegetation.					

Photo 1 of 1 : SP_2016_RD0536_209_13_20160516_00021.jpg



RD 536 Unit 2 looking downstream from levee mile 2.61 - 3.60 crown roadway.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
---	--	--	--	--	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2016

Reclamation District No. 0536 Egbert

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 Yolo Bypass	Right	5.01	03/30/2016 03/30/2016	Herman Phillips

LM Start	3.75	Rating **	M	Issue No.	10
LM End	3.76	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Erosion / Bank Caving		38.196982 °	38.196850 °	
			-121.688350 °	-121.688542 °	
DWR ID	DWR_RD0536_02_s_2012_10				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	---	---